

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2023–0658; Project Identifier MCAI–2023–00315–T; Amendment 39–22402; AD 2023–07–01]

RIN 2120–AA64

**Airworthiness Directives; Airbus Canada Limited Partnership Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. This AD was prompted by several unscheduled PW1500G engine removals due to certain crew alerting system (CAS) messages being displayed, high vibration, or debris found on the magnetic chip collector of a bearing compartment. This AD prohibits dispatch of an airplane with an affected engine having an applicable CAS message displayed, unless the bearing compartment chip collector and oil filter are inspected and any debris found is dispositioned, as specified in a Transport Canada AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective April 19, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain publications listed in this AD as of April 19, 2023.

The FAA must receive comments on this AD by May 19, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–0658; or in person at Docket Operations between 9 a.m. and

5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

*Material Incorporated by Reference:*

- For material incorporated by reference in this AD, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email [AD-CN@tc.gc.ca](mailto:AD-CN@tc.gc.ca); website [tc.canada.ca/en/aviation](https://tc.canada.ca/en/aviation).

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–0658.

**FOR FURTHER INFORMATION CONTACT:**

Joseph Catanzaro, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7366; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2023–0658; Project Identifier MCAI–2023–00315–T” at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt

from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Joseph Catanzaro, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7366; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov). Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

Transport Canada, which is the aviation authority for Canada, has issued Transport Canada Emergency AD CF–2023–12, dated February 23, 2023 (Transport Canada Emergency AD CF–2023–12) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes.

The MCAI states that since early 2021, there have been several unscheduled PW1500G engine removals due to CAS message L/R ENGINE FAULT with associated INFO message OIL DEBRIS ABOVE LIMIT being displayed, high vibration, or debris found on the magnetic chip collector of bearing compartment No. 3 (BC3). The investigation by Pratt & Whitney found that in most instances, the No. 3 bearings originated from a single manufacturing lot that have a possible defect.

In December 2022, an airplane experienced engine stall and uncommanded in-flight shutdown (IFSD) while in cruise. Prior to the IFSD event, the airplane had received advisory-level CAS message R ENGINE FAULT with associated INFO message 79 R ENGINE FAULT–OIL DEBRIS ABOVE LIMIT during the previous flight, and the fault was deferred in accordance with the approved minimum equipment list (MEL). The No. 3 bearing installed on the event engine was found to be from the suspect lot, and post-event inspection found metallic debris on the BC3 chip collector.

This AD is intended to prevent a No. 3 bearing failure. This condition, if not addressed, could result in unrecoverable engine failure or power loss for both engines and consequent reduced control of the airplane.

You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–0658.

**Related Service Information Under 1 CFR Part 51**

Transport Canada Emergency AD CF–2023–12 prohibits dispatch of an airplane with an affected engine having an applicable CAS message displayed, unless the BC3 chip collector and oil filter are inspected and any debris found is dispositioned. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this AD after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

**Requirements of This AD**

This AD requires accomplishing the actions specified in Transport Canada Emergency AD CF–2023–12 described previously, except for any differences

identified as exceptions in the regulatory text of this AD.

**Explanation of Required Compliance Information**

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, Transport Canada Emergency AD CF–2023–12 is incorporated by reference in this AD. This AD requires compliance with Transport Canada Emergency AD CF–2023–12 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in Transport Canada Emergency AD CF–2023–12 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the sections titled “Compliance” and “Corrective Actions” in Transport Canada Emergency AD CF–2023–12.

**FAA’s Justification and Determination of the Effective Date**

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those procedures are “impracticable, unnecessary, or contrary to the public

interest.” Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

An unsafe condition exists that requires the immediate adoption of this AD without providing an opportunity for public comments prior to adoption. The FAA has found that the risk to the flying public justifies forgoing notice and comment prior to adoption of this rule because a No. 3 bearing failure could result in unrecoverable engine failure or power loss for both engines and consequent reduced control of the airplane. Accordingly, notice and opportunity for prior public comment are impracticable and contrary to the public interest pursuant to 5 U.S.C. 553(b)(3)(B).

In addition, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days, for the same reasons the FAA found good cause to forgo notice and comment.

**Regulatory Flexibility Act (RFA)**

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

**Costs of Compliance**

The FAA estimates that this AD affects 84 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hour × \$85 per hour = \$85 .....	\$0	\$85	\$7,140

The FAA estimates it would take 2 hours for any required inspection and debris disposition at \$85 per hour, for a total cost of \$170 per engine.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or

develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

(1) Is not a “significant regulatory action” under Executive Order 12866, and

(2) Will not affect intrastate aviation in Alaska.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2023–07–01 Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.):** Amendment 39–22402; Docket No. FAA–2023–0658; Project Identifier MCAI–2023–00315–T.

##### (a) Effective Date

This airworthiness directive (AD) is effective April 19, 2023.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to Airbus Canada Limited Partnership (Type Certificate previously held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Model BD–500–1A10 and BD–500–1A11 airplanes, certificated in any category, as identified in Transport Canada Emergency AD CF–2023–12, dated February 23, 2023 (Transport Canada Emergency AD CF–2023–12).

##### (d) Subject

Air Transport Association (ATA) of America Code 72, Turbine/turboprop engine.

##### (e) Unsafe Condition

This AD was prompted by several unscheduled PW1500G engine removals due to crew alerting system (CAS) message L/R ENGINE FAULT with associated INFO message OIL DEBRIS ABOVE LIMIT being displayed, high vibration, or debris found on the magnetic chip collector of bearing compartment No. 3 (BC3). The FAA is issuing this AD to prevent a No. 3 bearing failure. The unsafe condition, if not addressed, could result in unrecoverable engine failure or power loss for both engines

and consequent reduced control of the airplane.

##### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

##### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, Transport Canada Emergency AD CF–2023–12.

##### (h) Exception to Transport Canada Emergency AD CF–2023–12

Where Transport Canada Emergency AD CF–2023–12 refers to its effective date, this AD requires using the effective date of this AD.

##### (i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada; or Airbus Canada Limited Partnership’s Transport Canada Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

##### (j) Additional Information

For more information about this AD, contact Joseph Catanzaro, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7366; email [9-avs-nyacos@faa.gov](mailto:9-avs-nyacos@faa.gov).

##### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Transport Canada Emergency AD CF–2023–12, dated February 23, 2023.

(ii) [Reserved]

(3) For Transport Canada Emergency AD CF–2023–12, contact Transport Canada,

Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email [AD-CN@tc.gc.ca](mailto:AD-CN@tc.gc.ca); website [tc.canada.ca/en/aviation](http://tc.canada.ca/en/aviation).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: [www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on March 28, 2023.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2023–06989 Filed 3–30–23; 4:15 pm]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA–2022–1454; Airspace Docket No. 21–AWP–56]

**RIN 2120–AA66**

#### Amendment of Class E Airspace; Boswell Airport, CA

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies the Class E airspace extending upward from 700 feet above the surface at Boswell Airport, CA. It reduces the radius, establishes an extension to the north, modifies the extension to the south, and it makes several administrative modifications to update the airport’s legal description. These actions will support the safety and management of instrument flight rule (IFR) operations at the airport.

**DATES:** Effective date 0901 UTC, June 15, 2023. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order JO 7400.11 and publication of conforming amendments.

**ADDRESSES:** A copy of the Notice of Proposed Rulemaking (NPRM), all comments received, this final rule, and all background material may be viewed online at [www.regulations.gov](http://www.regulations.gov) using the FAA Docket number. Electronic retrieval help and guidelines are